
Compact Pressure Switch

Series ZSE2 (For Vacuum)/ISE2 (For Positive Pressure)

For General Pneumatics



Can be integrated with ZX or RoHS ZR ejector system.

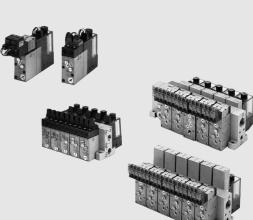

ISE30 ZSE40 ISE40

ISE40 ZSE10 ISE10

ISE70

ZSE80 ISE80 ZSE

ZSP

PS

ISA2

PSE

IS ISG


ZSM1

Easy and simple wiring

Connector type

Compact Pressure Switch Series ZSE2/ISE2

How to Order

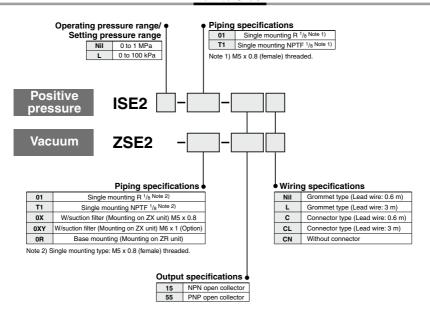

With Connector/How to Order

 Without lead wire (Connector 1 pc., Socket 3 pcs.) 	·····ZS-1	0-A
With lead wire	·····ZS-1	0-5A-🏳
Note) When ordering switch with 5 m long lead wire, indicate both part numbers.	wire le	ength •
both part numbers.	Nil	0.6 m
Ex.) ZSE2-01-15CN1 pc.	30	3 m
ZS-10-5 A-501 pc.	50	5 m

Replacement Element (Filter) Part Number (Refer to page 843)

Filter vessel assembly (Filter vessel, Filter element)	ZX 1-FK-PC
● Filter element	ZX1-FE
Filter gasket	ZX1-FG

Compact Pressure Switch Series ZSE2/ISE2

Specifications

For details about the Pressure Switch Precautions, refer to pages 763 and 764. For details about the Specific Product Precautions, refer to the Operation Manual at SMC website. Click here for details.

$\overline{}$					
Model		Model	ZSE2	ISE2L	ISE2
		Wiodei	For vacuum	For low pressure	For positive pressure
Rate	ed pressure	range/Set pressure range	0 to -101 kPa	0 to 100 kPa	0 to 1 MPa
Pro	Proof pressure 500 kPa		kPa	1.5 MPa	
Fluid			Air/Non-corrosive, non-flammable gas		
Power supply voltage		ply voltage	12 to 24 VDC ±10%, Ripple (P-P) 10% or less (With power supply polarity protection)		
Current consumption 17		17 mA or less at 24 VDC	17 mA or less at 24 VDC		
Re	sponse	time	5 ms or less		
Repeatability			±1% F.S. or less		
92	Enclos	ure	IP40		
Enclosure			Operating: 0 to 60°C, Stored: -10 to 60°C (With no condensation and no freezing)		
Operating humidity range			Operating/Stored: 35 to 85%RH (With no condensation)		
Temperature characteristics(Based on 25°C)		racteristics(Based on 25°C)	±3% F.S. or less		
Withstand voltage		voltage	1000 VAC for 1 min. (between terminals and housing)		
Ins	ulation	ation resistance 50 MΩ or more (500 VDC measured via megohmmeter) between terminals and housing			een terminals and housing
Port size			01: R 1/8, M5 x 0.8 T1: NPTF 1/8, M5 x 0.8		
			0X: With suction filter (For mounting on ZX unit) 0R: Base mount type (For mounting on ZR unit)		
We	ight		35 g (Including 0.6 m-Long lead wire)		
La	ad wire	Grommet type	Oilproof heavy-duty vinyl cable 3 cores, ø3.4, Conductor area: 0.2 mm², Insulator O.D.: 1.1 mm		
Lea	au Wire	Connector type	Heat-resistant vinyl electric wire, 3-wire, Conductor area: 0.31 mm², Insulator O.D.: 1.55 mm		m², Insulator O.D.: 1.55 mm
Sta	andard		CE, RoHS		

Output Specifications

Model	-15	-55	
Switch output	NPN open collector 30V, 80 mA or less	PNP open collector 80 mA or less	
Residual voltage	1 V or less (With load current of 80 mA)		
Number of outputs	1		
Hysteresis	3% F.S. or less (Fixed)		
Indicator light	ON: when output is ON (Red)		
Trimmer adjustment	200°		

ZSE30 ISE30 ZSE40 ISE40 ZSE10 ISE10

ZSE80 ISE80 ZSE

ZSP

PS

ISA2

PSE IS


ISG

ZSM1

Series ZSE2/ISE2

Calibration Procedure

 Set the ON-pressure by the pressure setting trimmer. Turning clockwise can set the high pressure/high vacuum pressure.

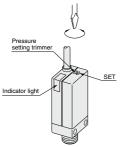

 Set the possible min. pressure for adsorption confirmation. If setting the pressure lower than that, switch becomes ON in case that adsorption is not completely done. If setting the pressure higher than that, switch does not become ON even though it may absorb workpieces.




• Regarding the pressure setting

. Caution

Observe the following precautions for setting the vacuum pressure: Use your fingertips to gently turn the screwdriver. Do not use a screwdriver with a large grip or with a tip that does not fit into the trimmer groove because this could strip the groove.

Hysteresis


Hysteresis is the pressure difference between the ON and the OFF pressure of the output signal. The set pressure is the pressure selected to switch from OFF to ON condition.



How to Use Connector

1. Attaching and detaching connectors


- When assembling the connector to the switch housing, push the connector straight onto the pins until the lever locks into the housing slot.
- When removing the connector from the switch housing, push the lever down to unlock it from the slot and then withdraw the connector straight off of the pin.

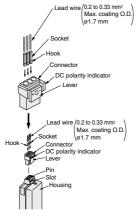

2. Crimping of lead wires and sockets

Strip 3.2 to 3.7 mm at the end of the lead wires, insert the ends of core wires evenly into the sockets, and then crimp with a crimping tool. When this is done, take care that the coverings of the lead wires do not enter the core wire crimping area.

(Crimping tool: model no. DXT170-75-1)



3. Attaching and detaching lead wires with sockets

Attaching

Insert the sockets into the square holes of the connector (with +, 0, – indication), and continue to push the sockets all the way in until they lock by hooking into the seats in the connector. (When they are pushed in their hooks open and they are locked automatically.) Then confirm that they are locked by pulling lightly on the lead wires.


Detaching

To detach a socket from a connector, pull out the lead wire while pressing the socket's hook with a stick having a thin tip (about 1 mm). If the socket will be used again, first spread the hook outward.




Internal Circuits and Wiring Examples

-15 NPN (1 output)




-55 PNP (2 outputs)



How to Replace Filter Element

If the filter element becomes clogged, leading to a reduced adsorption force or delayed response time, stop the operation and re-place the element.

(Element part number ZX1-FE) Verify that the filter gasket is placed properly in the gasket groove before installing an element.

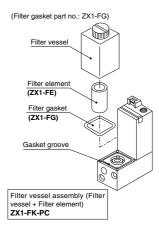

Filter vessel


↑ Caution

- Do not use with thinner, carbon tetrachloride, chloroform, acetate, aniline, cyclohexane, trichloroethylene, sulfuric acid, lactic acid and watermiscible cutting fluid (alkaline).
- 2. Operate it away from direct sunlight.


Compact Pressure Switch Series ZSE2/ISE2

Dimensions

With Suction Filter: ZSE2-0X□

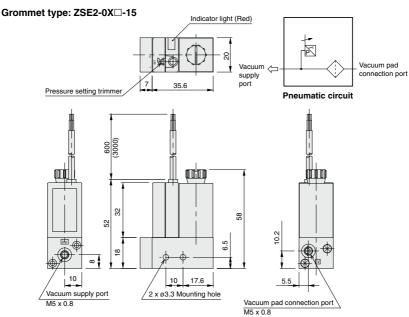

Connector type: ZSE2-0X□-15C

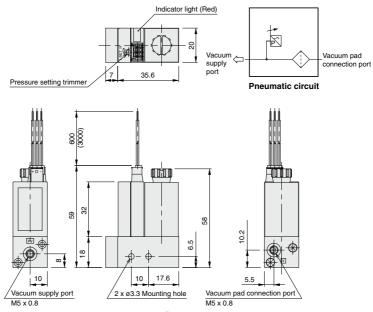

ZSE30 ISE30

ZSE40

ISE40

ZSE10 ISE10

ZSE80 ISE80 ZSE

ZSP PS

ISA2

PSE

IS

ISG


ZSM1

Series ZSE2/ISE2

Dimensions


Standard Type: ZSE2-01

Grommet type: ZSE2- 01 -15

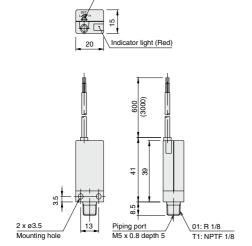


Pressure setting trimmer



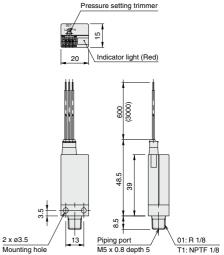


Base Mount Type: ZSE2-0R

Grommet type: ZSE2-0R-15

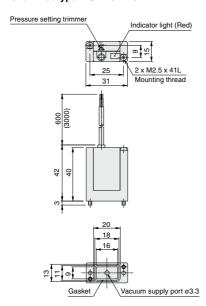

Connector type: ZSE2-0R-15C

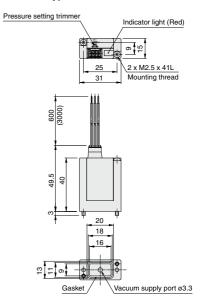


Compact Pressure Switch Series ZSE2/ISE2


Dimensions

ISE2□-01

Grommet type: ISE2- 01/1-15

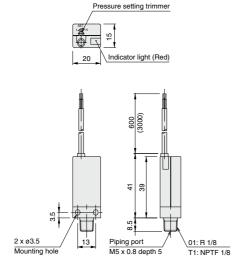

Connector type: ISE2- 01-15C

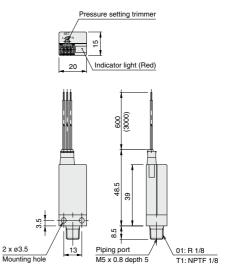

ZSE30 ISE30 ZSE40 ISE40 ZSE10 ISE10

ZSE80 ISE80 ZSE

ZSP PS ISA2

PSE

ISG ZSM1